LEGEND – LUMP SUM WORK

- PERFORM DEEP REPOINTING OF 100% MORTAR JOINTS; SEE ITEM 1.1.2 ON EN–0.2 AND DETAIL 1/EN–2.1. SOUND 100% OF MASONRY, REMOVE ALL LOOSE STONE.
- REMOVE AND RESET COPING STONE WITH THROUGH–WALL FLASHING; SEE DETAIL 1/EN–2.2
- REMOVE, CLEAN AND RESET STONES AT TURRET WITH THROUGH–WALL FLASHING; SEE DETAIL 2/EN–2.2

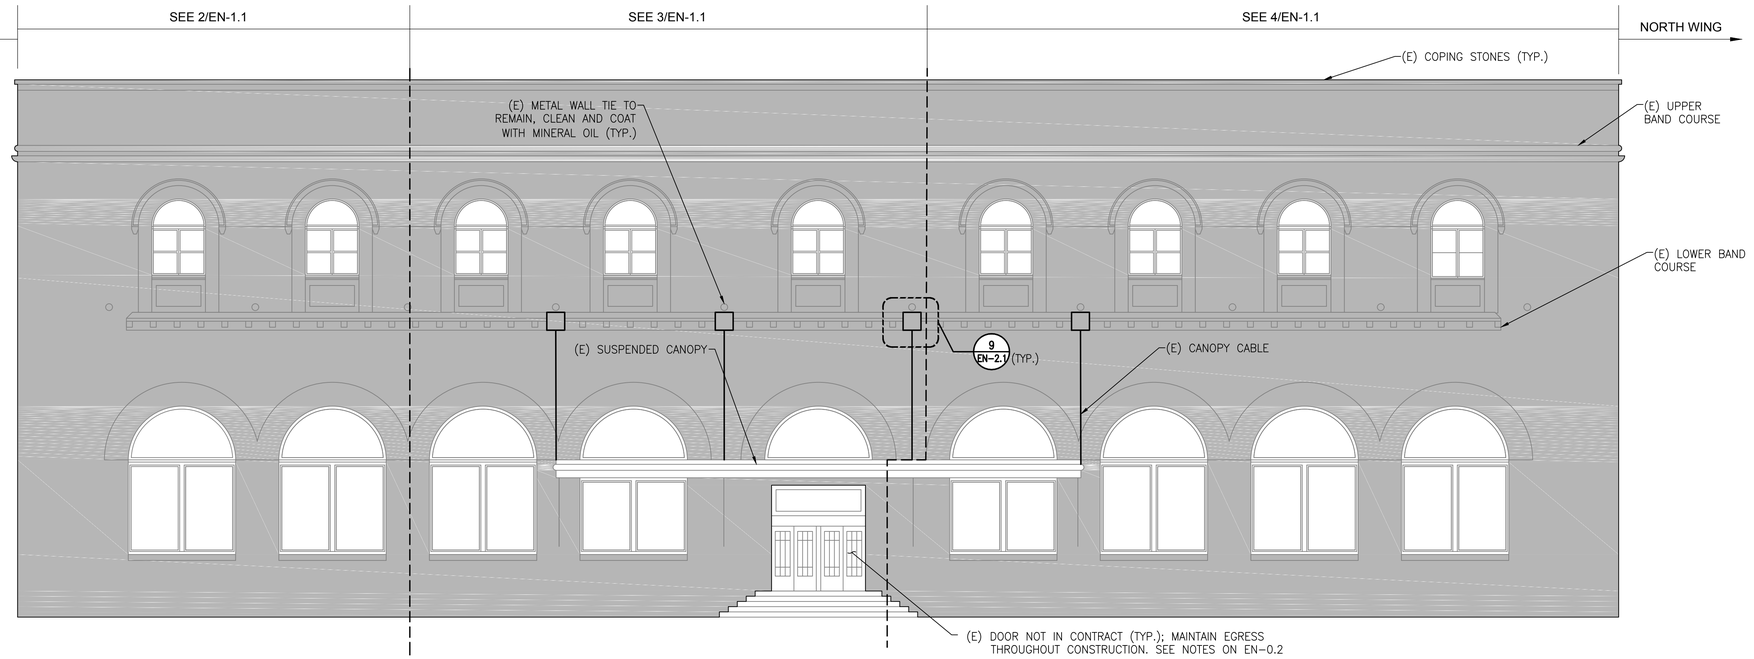

1 EN-1.1 EAST FACADE (CENTER WING) – ELEVATION
APPROXIMATE SCALE: 1/8" = 1'–0" (V.I.F.)

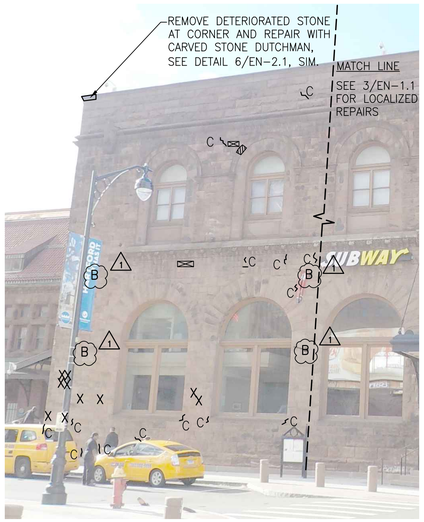

2 EN-1.1 EAST FACADE (CENTER WING) – PHOTO
SCALE: NTS

3 EN-1.1 EAST FACADE (CENTER WING) – PHOTO
SCALE: NTS

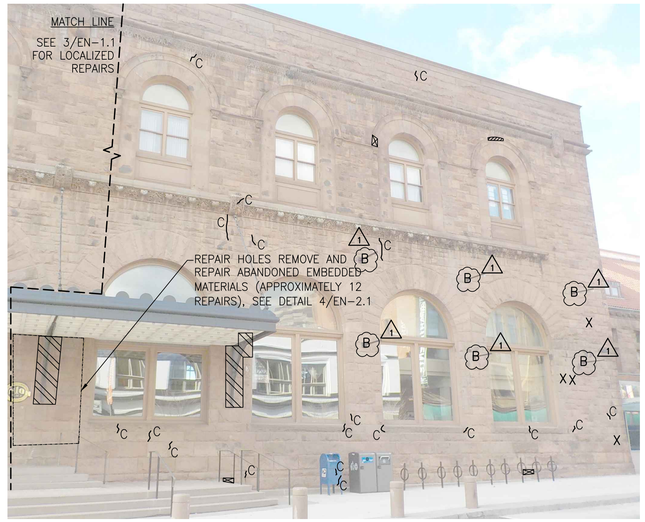

4 EN-1.1 EAST FACADE (CENTER WING) – PHOTO
SCALE: NTS

LEGEND – UNIT PRICE WORK

- C CRACK REPAIR; SEE DETAIL 2/EN–2.1
- STONE REPAIR AT HOLE; SEE DETAIL 4/EN–2.1
- X STONE REPAIR AT ABANDONED FASTENER; SEE DETAIL 4/EN–2.1
- STONE SURFACE REDRESSING; SEE DETAIL 7/EN–2.2
- B REMOVE (E) BRACKET AND FILL HOLES WHERE FASTENERS ARE REMOVED WITH REPAIR MORTAR. SEE 4/EN–2.1. (1)
- STONE REPAIR WITH REPAIR MORTAR, SEE DETAIL 5/EN–2.1
- WHOLE STONE REPLACEMENT; SEE DETAIL 3/EN–2.1
- STONE REPAIR WITH DUTCHMAN; SEE DETAILS 6, 8/EN–2.1

GENERAL NOTES:

1. LUMP SUM MASONRY SCOPE IS INDICATED ON THE ELEVATIONS (1/EN–1.1). UNIT PRICE MASONRY WORK KNOWN TO DATE IS INDICATED ONLY ON THE PHOTOS (2,3,4/EN–1.1). PHOTOS OVERLAP – UNIT PRICE WORK KNOWN TO DATE IS INDICATED ON ONE PHOTO ONLY. OTHER UNIT PRICE WORK, NOT CURRENTLY SHOWN, MAY BE ADDED – SEE NOTE 2.
2. A SUMMARY TABLE OF THE UNIT PRICE QUANTITIES IS FOUND ON EN–0.2. QUANTITIES IN THIS TABLE INTENTIONALLY EXCEED THOSE GRAPHICALLY INDICATED ON SHEETS EN–1.1 – EN–1.3 TO ACCOUNT FOR ADDITIONAL REPAIR LOCATIONS AND QUANTITIES NOT APPARENT WITH A VISUAL SURVEY. FOR PRICING AND BIDDING PURPOSES, USE THE QUANTITIES IN THIS TABLE, DO NOT TAKE–OFF QUANTITIES FROM ELEVATION SHEETS. ENGINEER TO REVIEW AND DIRECT ANY ADDITIONAL REPAIR LOCATIONS IDENTIFIED IN THE FIELD.
3. ACCURACY OF DIMENSIONS UNKNOWN, BASED ON (E) DRAWINGS. CONTRACTOR TO VERIFY IN FIELD PRIOR TO BIDDING.
4. WINDOWS AND DOORS NOT IN CONTRACT

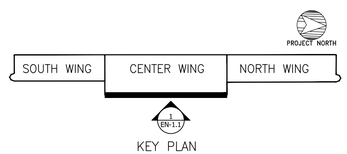

KEY PLAN

SIMPSON GUMPERTZ & HEGER
Engineering of Structures and Building Enclosures

Simpson Gumpertz & Heger Inc.
41 Seyon Street, Building 1, Suite 500
Waltham, Massachusetts 02453
main: 781.907.9000 fax: 781.907.9009
www.sgh.com

Boston
Chicago
Houston
Los Angeles
New York
San Francisco
Washington, DC

Greater Hartford Transit District

GHTD PROJECT NO. 07–017

Owner, Client

BID DOCUMENTS

No.	Date	Description	By
1	8/18/17	ADDENDUM 1	JCD

UNION STATION TRANSPORTATION CENTER

BROWNSTONE MASONRY REPAIRS

Project: 1 UNION PLACE HARTFORD, CT

EAST ELEVATION (CENTER WING)

Drawing Title

SGH Project No.	Checked	Date
130525.02	KSW	07/31/17
Drawn: JLT	Approved: MBB	Scale: AS SHOWN

Drawing No. EN-1.1

Seal